OPERATION & MAINTENANCE MANUAL <u>Filterra</u>

Manual prepared: September 2017

DFI No. D00709



Figure 1: DFI No. D00709, looking East

1. Identification

Drainage Facility ID (DFI): D00709 Facility Type: Filterra

Construction Drawings: (V-File Numbers) 46V-051

Location: District: 03

Highway No.: 140 Mile Post: 36.607, LT

2. Manual Purpose

The purpose of this manual is to outline inspection needs and summarize maintenance actions for planted water quality catch basins.

3. Facility Location

The location map below details the facility location. The highway, mile posts, side streets, access location, and stormwater flow directions are noted on the map.

Facility location type: <u>Curb and Gutter (bike lane)</u>

Flow direction: East




Figure 2: Facility Location Map

4. Facility Summary

The length and width of the WQ Catch Basin is based on the dimensions of the inside of the treatment cell.

The length and width of the WQ Catch Basin is:

| Length (Feet) | Width (Feet) | Designation Number ¹ |
|---------------|--------------|------------------------------------|
| 6 | 4 | FT0604 |

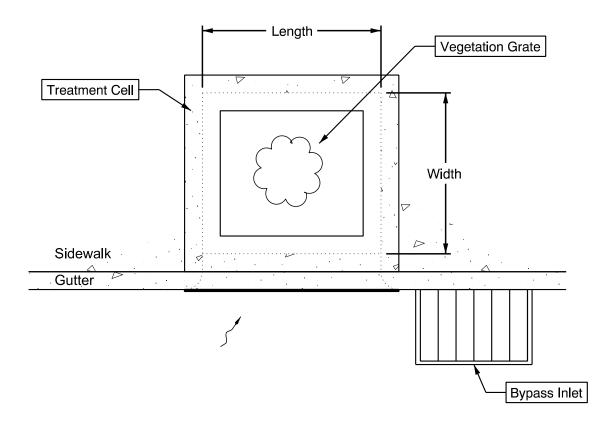

<u>Site Specific Information:</u> Located on the West side of the I-5 Woodburn Interchange. See Appendix B for additional information.

¹ The Filterra and MWS designation number is associated with the dimensions of this type of proprietary structure. See appendix C of the Standard Operation Manual for Water Quality Catch Basins to view the Configuration Details for additional information.

5. Facility Access

Maintenance access to the facility: Curb and gutter (travel lane)

Image ■ Lane Closure Needed

Water quality catch basins do not typically have access roads/access pads, nor are they gated, as they are located in urban areas alongside sidewalks and curbs. Use caution when accessing these facilities as there may be pedestrians or cyclists in the vicinity.

6. Operational Components / Maintenance Items

Classification and Standard Operational (Op) Plan:

This facility is classified as a:

| ⊠ Filterra (Op Plan A) | □ WQ Planter (Op Plan B) | □ MWS (Op Plan C) | | | |
|--|--|--|--|--|--|
| A Filterra is a single chamber treatment cell that utilizes filter media, a plant, and a perforated underdrain. | A WQ Planter is a single chamber treatment cell that utilizes plants, filter media, and a perforated underdrain. The auxiliary outlet is located inside of the treatment cell. | A Modular Wetland System is a three chamber treatment cell that utilizes plants, filter media, filter media cartridges, and a perforated underdrain network. | | | |
| A standard operational plan illustrates the general facility footprint configuration and explains the purpose of each facility component. Operational plans (A and B) are provided in the Standard Operation Manual. | | | | | |

See Appendix A for the site specific operational plan.

Operational Components

The facility components table (**Table 1**) has been provided to highlight the applicable components for this facility. The component is in use when the box contains an "x" (e.g. \boxtimes).

The Standard Operation Manual for Water Quality Catch Basins (implemented April 2018) outlines facility operation, typical footprint configuration, and component definitions and details. A link to the manual is attached to the feature marker in TransGIS. https://gis.odot.state.or.us/TransGIS/

Maintenance Items

Operational components marked in **Table 1** should be inspected and maintained according to Section 7. Each facility component is defined and detailed in the Standard Operation Manual using the associated ID number indicated below.

| Table 1: Facility Components | ID# | |
|------------------------------|------------|------------|
| Facility Inlet | | |
| Inlet Grate | | C1 |
| Curb Inlet | X | C2 |
| Sidewalk Chute | | C 3 |
| Bypass Inlet | X | C4 |
| Treatment | | |
| Plantings (Tree or Shrub) | X | C5 |
| Filter Media | X | C6 |
| Filter Media Cartridge | | C7 |
| Outfall Type | | |
| | C | |
| Waterbody (Creek/Lake/Ocean) | □L | C8 |
| | □ o | |
| Ditch | | C9 |
| Storm Drain System | × | C10 |

7. Maintenance

Maintenance Frequency/Maintain Records

- a. Inspect per manufacturer requirements. Preferably prior to the rainy season.
- b. Clean and maintain as necessary. Refer to Activity 125 in the Maintenance Guide for conditions when maintenance is needed.
- c. Keep a record of inspections, maintenance, and repairs.

Maintenance Guide/Maintenance Actions

Proprietary Water Quality Catch Basins have an operation and maintenance manual provided by the manufacturer. See Appendix C of the Standard Operational Manual for Water Quality Catch Basins. These manuals provided guidelines on maintenance procedures for the facilities. A link to the manual is attached to the feature marker in TransGIS. https://gis.odot.state.or.us/TransGIS/

The Maintenance Guide outlines the standard maintenance actions for water quality facilities under Activity 125.

There are standard maintenance tables for standard ODOT designs. The maintenance tables describe the maintenance component, the defect or problem, the condition when maintenance is needed, and the recommended maintenance to correct the problem. Use the following tables to maintain ODOT Water Quality Catch Basins:

 Table 1 (General Maintenance): Contains general maintenance and inspection guidelines that are applicable to all ODOT water quality facilities

The ODOT Maintenance Guide can be viewed at the following website:

http://www.oregon.gov/ODOT/HWY/OOM/pages/mguide.aspx

8. Waste Material Handling


Material removed from the facility is defined as waste by the Department of Environmental Quality (DEQ). Refer to the road waste section of the ODOT Maintenance Yard Environmental Management System (EMS) Policy and Procedures Manual for disposal options:

http://www.oregon.gov/ODOT/HWY/OOM/pages/ems.aspx

Contact any of the following for more detailed information about management of waste materials found on site:


| ODOT Clean Water Unit | (503) 986-3008 |
|-----------------------------------|----------------|
| ODOT Statewide Hazmat Coordinator | (503) 667-7442 |
| ODOT Region 1 Hazmat Coordinator | (503) 731-8290 |
| ODOT Region 2 Hazmat Coordinator | (503) 986-2647 |
| ODOT Region 3 Hazmat Coordinator | (541) 957-3594 |
| ODOT Region 4 Hazmat Coordinator | (541) 388-6186 |
| ODOT Region 5 Hazmat Coordinator | (541) 963-1590 |
| ODEQ Northwest Region Office | (503) 229-5263 |

| Α | Appendix A – Site Specific Operational Plan |
|-------|---|
| Conf | tents: |
| Opera | ational Plan: DFI D00709 |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |

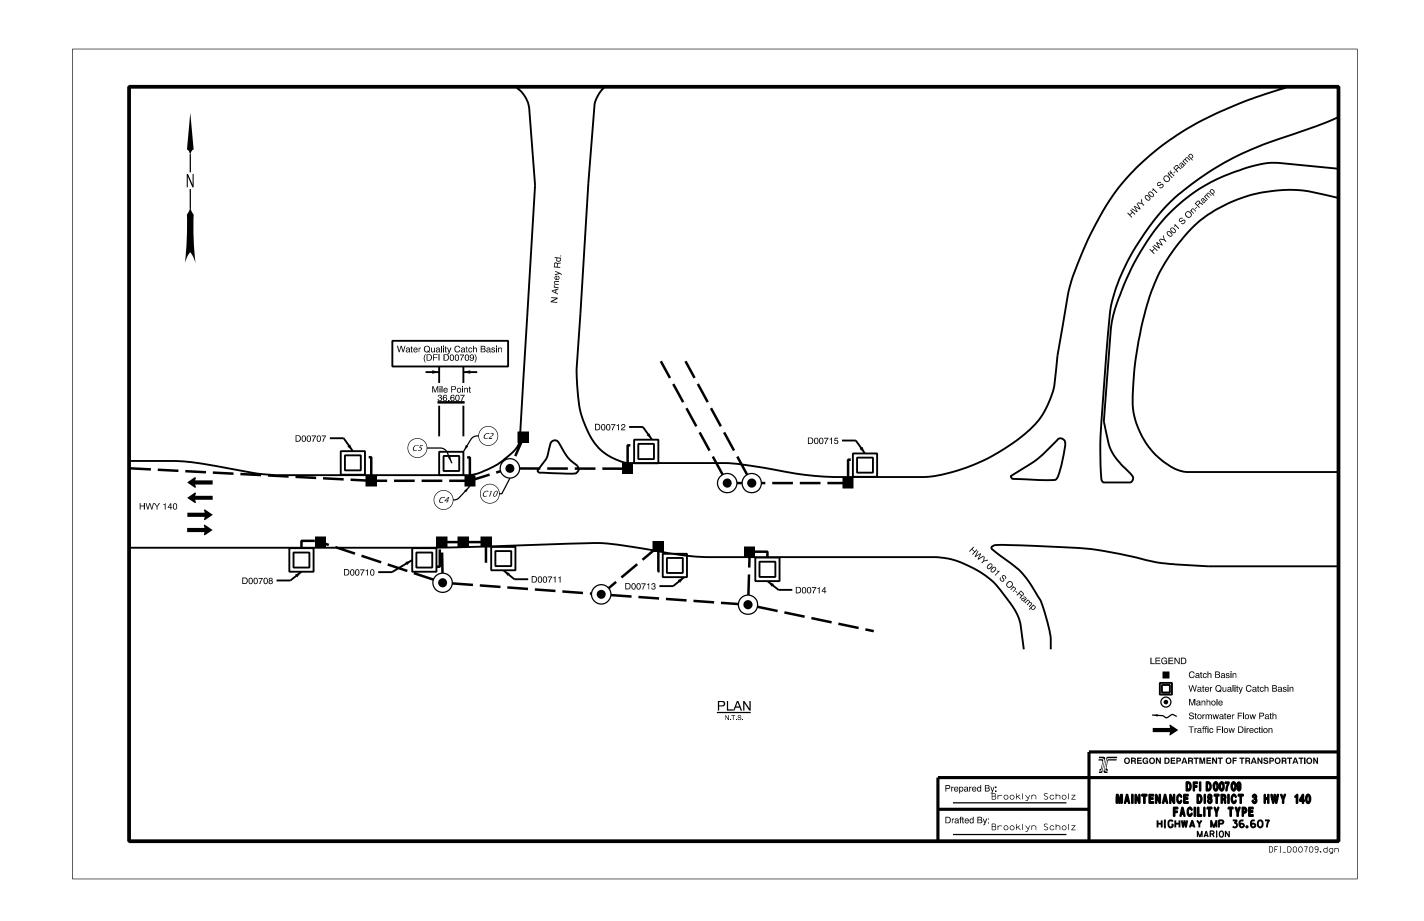

| В | Append | ix B – Pro | ject Cont | ract Plan | S | | |
|------|-------------|--------------|------------|-------------|------|--|--|
| Con | ntents: | | | | | | |
| Site | Specific Su | bset of Proj | ect Contra | ct Plan 46V | -051 | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |

46V-51

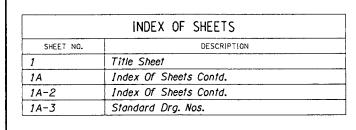

CONTRACT PROJECT

BEGINNING OF


STATE OF OREGON DEPARTMENT OF TRANSPORTATION PLANS FOR PROPOSED PROJECT

GRADING, DRAINAGE, STRUCTURES, PAVING, SIGNING, **ILLUMINATION, SIGNAL & ROADSIDE DEVELOPMENT**

FFO - I-5 @ OR214 INTERCHANGE (WOODBURN) DEVELOPMENT SEC.

HILLSBORO - SILVERTON HIGHWAY

MARION COUNTY & JUNE 2013

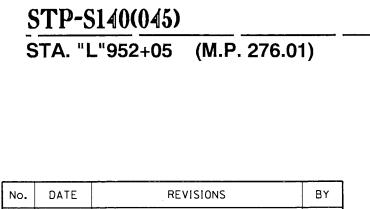

| No. | DATE | REVISIONS | BY |
|-------------|---------|---|--------|
| \triangle | 4-18-13 | Edited station & MP for the end of contract | J.O.L. |
| <u>6</u> | 5-16-13 | Changed date | C.A.C. |
| | | | |
| | | | |

BEGINNING OF PROJECT STP-S140(045) STA. "HSc"477+21

(M.P. 36.24)

END OF CONTRACT PROJECT STP-S140(045)

△ STA. "L"1199+66.06 (M.P. 271.35)

T. 5 S. WOODBURN

tdb081

Woodburn

END OF PROJECT STP-S140(045)

STA. "HSc"562+67.5 (M.P. 37.87)

Overall Length Of Project - 2.76 Miles

Adopted By The Oregon Utility Notification Center. Those Rules are Set Forth in OAR 952-001-0010 Through OAR 952-001-0090. You May Obtain Copies Of The Rules By Calling The Center. (Note: The Telephone Number For The Oregon Utility Center Is (503) 232-1987.)



OREGON TRANSPORTATION COMMISSION

Pat Egan COMMISSIONER Mary F. Olson COMMISSIONER Mork Frohnmaye COMMISSIONER

Tammy Baney COMMISSIONER DIRECTOR OF TRANSPORTATION

These plans were developed using ODOT design standards. Exceptions to these standards, if any, have been submitted and approved by the ODOT Chief Engineer or their delegated


Michael T. Long - R2 Tech Center Manager

Concurrence by ODOT Chief Engineer

FFO - I-5 @ OR214 INTERCHANGE (WOODBURN) DEVELOPMENT SEC. HILLSBORO - SILVERTON HIGHWAY
MARION COUNTY

| FEDERAL HIGHWAY ADMINISTRATION | PROJECT NUMBER | SHEET NO. |
|-----------------------------------|----------------|--------------|
| OREGON DIVISION | STP-S140(045) | 1 |


T. 4 S

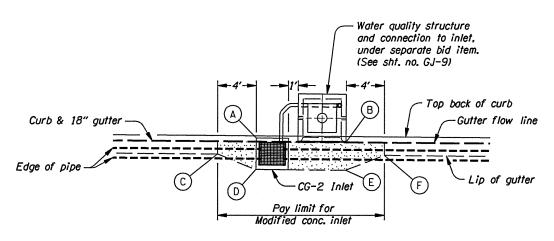

(For details not shown, see drg. nos. RD366 & RD700)


CG-2 MODIFIED INLET (SINGLE WATER QUALITY STRUCTURE)

- 1. Stage one construction: omit gutter section, place inlet at top of HMAC base course.
- 2. Construct water quality structures at final grade.
- 3. Construct temporary asphalt concrete wedge on leading edge of guttter section.
- 4. Complete construction of gutter section and adjust inlet for HMAC wearing course.

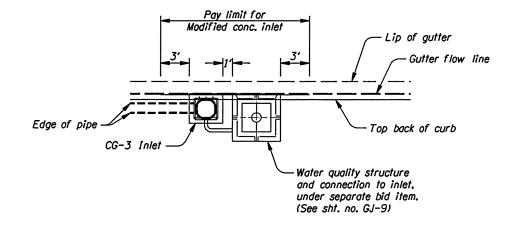

(For details not shown, see drg. nos. RD371 & RD700)


CG-3 MODIFIED INLET (SINGLE WATER QUALITY STRUCTURE)

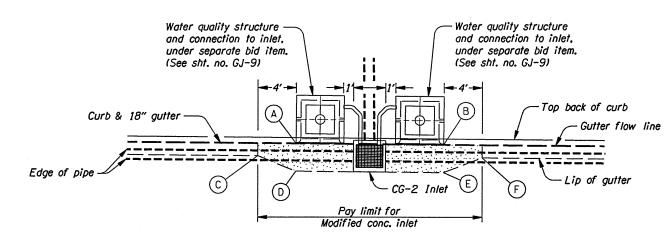

(For details not shown, see drg. nos. RD366 & RD700)

CG-2 MODIFIED INLET (DOUBLE WATER QUALITY STRUCTURE)

- 1. Stage one construction: omit gutter section, place inlet at top of HMAC base course.
- 2. Construct water quality structures at final grade.
- 3. Construct temporary asphalt concrete wedge on leading edge of gutter section.
- 4. Complete construction of gutter section and adjust inlet for HMAC wearing course.

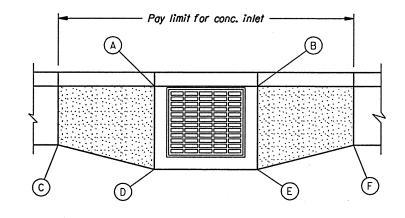

(For details not shown, see drg. nos. RD366 & RD700)

STAGE CONSTRUCTION FOR CG-2 INLET

NOTES:

- 1. Stage one construction: omit gutter section, place inlet at top of HMAC base course.
- 2. Construct temporary asphalt concrete wedge on leading edge of gutter section.
- 3. Complete construction of gutter section and adjust inlet for HMAC wearing course.

Omitted stage I gutter section shown thus:





OREGON DEPARTMENT OF TRANSPORTATION



(WOODBURN) DEVELOPMENT SEC. HILLSBORO - SILVERTON HIGHWAY
MARION COUNTY


Design Team Leader - Carol Cartwright Designed By - John Lucas Drafted By - Charlotte Gerken

DETAILS

2B-15

SHEET NO.

OREGON RENEWS: 12-31-2013

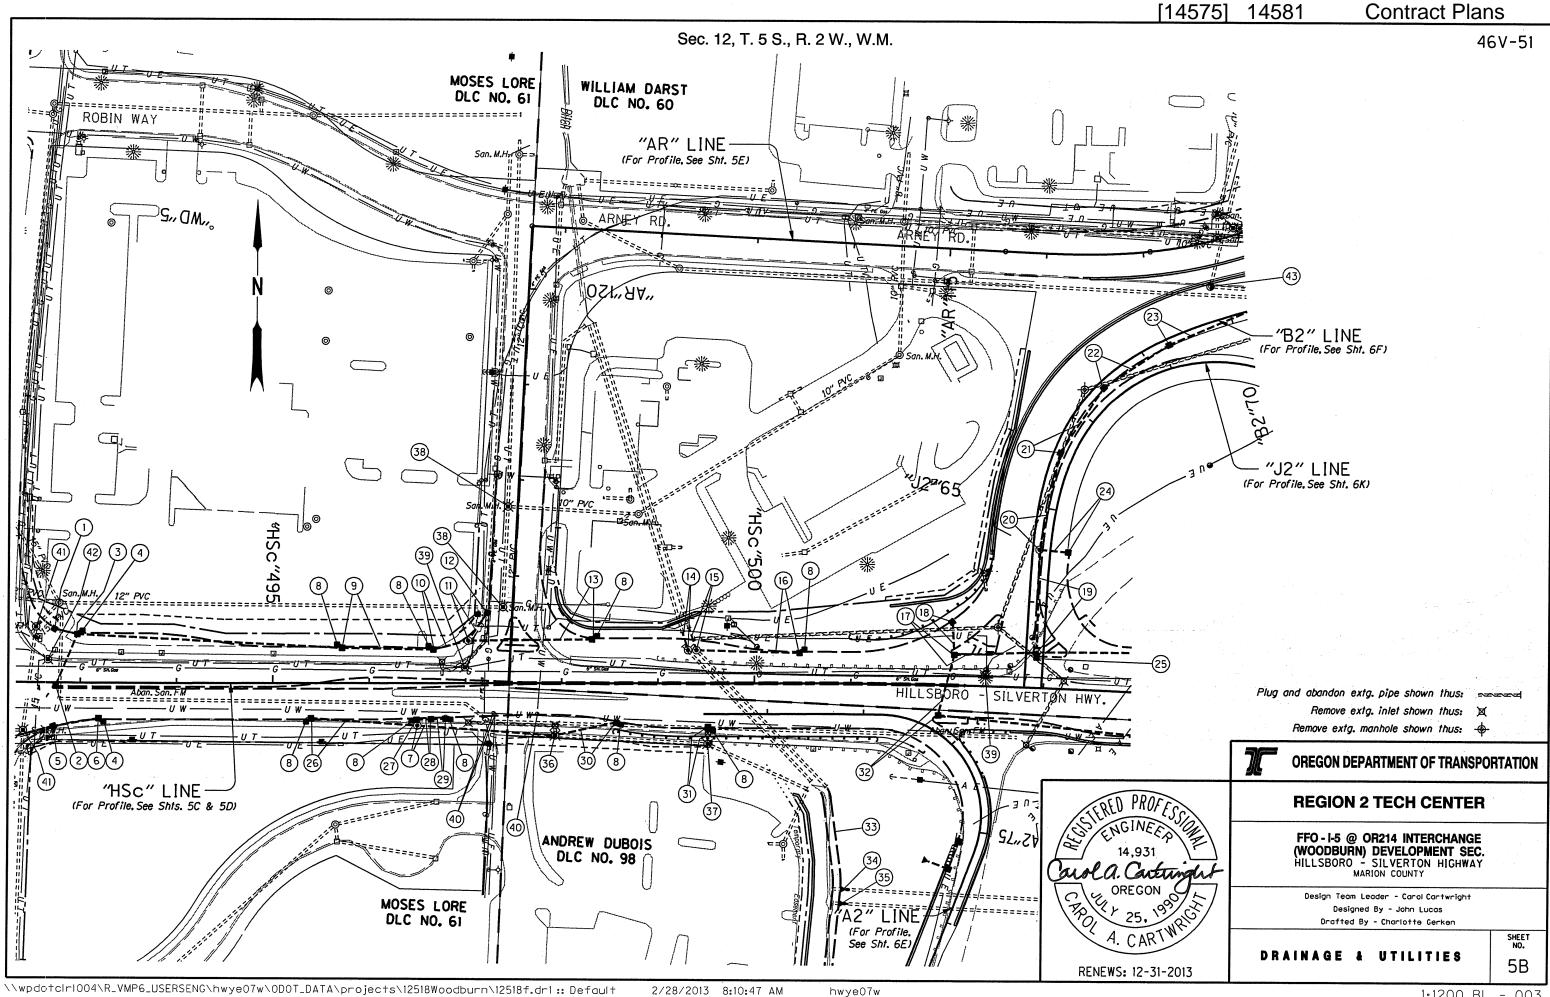

46V-51

- (1) See sht. 4B-2, note 18 Const. inlet Inst. pipe
- (2) See sht. 4B-2, note 20 Const. inlet Inst. pipe
- (3) See sht. 4B-2, note 19 Const. inlet Inst. pipe
- (4) See sht. 4B-2, note 2 Const. water quality structure
- (5) See sht. 4B-2, note 32 Const. inlet Inst. pipe
- (6) See sht. 4B-2, note 36 Const. inlet Inst. pipe
- (7) Sta. "HSc"496+50 to Sta. "HSc"497+93, Rt. Const. manhole Step orientation - 314° Inst. 12" storm sew. pipe - 144' 5' depth Connect to extg. manhole
- (8) Const. water quality structure 9 Connect to inlet (For details, see shts. GJ-10 & GJ-11)
- (9) Sta. "HSc"495+72 to Sta. "HSc"496+66.4, Lt. Const. type "CG-2" Mod. inlet Ad just inlet Inst. 12" storm sew. pipe - 94' 5' depth (For details, see sht. 2B-15)
- (10) Sta. "HSc"496+66.4 to Sta. "HSc"497+02.6, Lt. Const. type "CG-2" Mod. inlet Adjust inlet Inst. 12" storm sew. pipe - 37' 5' depth (For details, see sht. 2B-15)


- (11) Sta. "HSc"497+02.6 Lt. to Sta. "AR"123+39.8, Rt. Const. manhole Step orientation - 219° Minor adjust manhole Inst, 12" storm sew. pipe - 35' 5' depth
- (12) Sta. "AR" 123+39.8 Rt. Const. type "CG-2" inlet Ad iust inlet Connect to extg. storm sew. pipe (For details, see sht. 2B-15)
- (13) Sta. "HSc"497+02.6 to Sta. "HSc"498+31.2, Lt. Const. type "CG-2" Mod. inlet Ad just inlet Inst. 12" storm sew. pipe - 129' 5' depth (For details, see sht. 2B-15)
- (14) Sta. "HSc"499+25,5 to Sta. "HSc"499+31.3, Lt. Const. manhole 84" dia. Minor adjust manhole Inst. 54" storm sew. pipe - 20' 10' depth Connect to extg. 54" culverts (For details, see sht. GJ-6)
- (15) Sta. "HSc"499+32.3 to Sta. "HSc"499+40, Lt. Const. manhole 84" dia. Minor adjust manhole Inst. 54" storm sew. pipe - 25' 10' depth Connect to extg. 54" culverts (For details, see sht. GJ-6)
- (16) Sta. "HSc" 499+40 to Sta. "HSc" 500+46.5, Lt. Const. type "CG-2" Mod. inlet Adjust inlet Inst, 12" storm sew. pipe - 106' 5' depth (For detoils, see sht. 2B-15)
- (17) Sta. "HSc"502+06.7, Lt. to Sta. "B2"74+52.7, Lt. Const. type "CG-2" inlet Ad iust inlet Inst. 12" storm sew. pipe - 84 5' depth (For details, see sht. 2B-15)
- (18) Sta, "HSc"502+03.6 to Sta. "HSc"502+06.7. Lt. Const. type "CG-2" inlet Ad iust inlet Inst. 12" storm sew. pipe - 32' 5' depth (For details, see sht. 2B-15)

- (19) Sta. "B2"74+52.7 to Sta. "B2"73+45.3, Lt. Const. manhole Step orientation - 134° Minor adjust manhole Inst. 12" storm sew. pipe - 107' 5' depth
- (20) Sta. "B2"73+45.3 to Sta. "B2"72+40, Lt. Const. manhole Step orientation - 263° Inst. 12" storm sew. pipe - 102' 5' depth
- (21) Sta. "B2"72+40 to Sta. "B2"71+55, Lt. Const. type "G-2" inlet Inst. 12" storm sew. pipe - 80' 5' depth (See drg. no. RD364)
- (22) Sta, "B2"71+55 to Sta, "B2"70+71.2, Lt. Const. type "G-2" inlet Inst. 12" storm sew. pipe - 80' 5' depth
- (23) Sta. "B2"70+71.2 to Sta. "B2"67+06, Lt. Const. type "G-2" inlet Inst. 15" storm sew. pipe - 362' 5' depth
- (24) Sta. "J2"64+57.1, Rt. to Sta. "B2"73+45.3, Lt. Const. type "G-2" inlet Inst. 12" storm sew. pipe - 27 5' depth
- (25) Sta. "HSc"502+91.8, Lt. Const. type "CG-2" inlet Adjust inlet Inst. 12" storm sew. pipe - 5' 5' depth
- 126 Sta. "HSc"495+40 to Sta. "HSc"496+50, Rt. Const. type "CG-2" Mod. inlet Adjust inlet Inst. 12" storm sew. pipe - 110' 5' depth (For details, see sht, 2B-15)
 - (27) Sta. "HSc" 496+49.1 to Sta. "HSc" 496+50, Rt. Const. type "CG-3, Mod." inlet Inst. 12" storm sew. pipe - 6' 5' depth (For details, see sht, 2B-15) (See drg. nos. RD371, RD372 & RD373)

- (28) Sta. "HSc"496+49.1 to Sta. "HSc"496+64.1, Rt. Const. type "CG-3" inlet Inst. 12" storm sew. pipe - 15' 5' depth
- (29) Sta. "HSc" 496+64.1 to Sta. "HSc" 497+79.1, Rt. Const. type "CG-3, Mod." inlet Inst. 12" storm sew. pipe - 15' 5' depth (For details, see sht. 2B-15)
- (30) Sta. "HSc"497+93.3 to Sta. "HSc"498+56.6, Rt. Const. type "CG-3, Mod." inlet Inst. 12" storm sew. pipe - 64 5' depth Connect to exta. manhole (For details, see sht. 2B-15)
- (31) Sta. "HSc"499+51.7 to Sta. "HSc"499+52.1, Rt. Remove exta. inlet Remove extg. pipe - 13' Const. type "CG-2" Mod. inlet Ad just inlet Inst. 12" storm sew. pipe - 18' 5' depth Connect to extg. manhole (For details, see sht. 2B-15)
- (32) Sta. "HSc"501+91.5, Rt. to Sta. "HSc"502+06.7, Lt. Const. type "CG-2" inlet Ad just inlet Inst. 12" storm sew. pipe - 63' 5' depth (For details, see sht, 2B-15)
 - (33) See sht. 15B-2. note 14 Const. channel change
- (34) See sht. 15B-2, note 12 Inst. pipe
- (35) See sht. 15B-2, note 13 Inst. pipe

| 36) Sta. "HSc"497+93.3, Rt. |
|-----------------------------|
| Minor adjust manhole |
| |

- (37) Sta. "HSc"499+51.7, Rt. Minor adjust manhole
- (38) Minor adjust manhole 2 (For details, see sht. 2B-23)
- (39) Adjust manhole 2 (By others)
- (40) Adjust water valve box 3 (For details, see sht. 2B-22)
- (41) See sht. 4B-2, note 39 Minor adjust manhole
- (42) See sht. 4B-2. note 40 Adjust manhole (By others)
- (43) Sta. "B2"70+11.3, Rt. Major adjust manhole

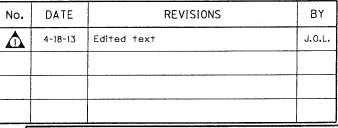





RENEWS: 12-31-2013

REGION 2 TECH CENTER


FFO - I-5 @ OR214 INTERCHANGE (WOODBURN) DEVELOPMENT SEC. HILLSBORO - SILVERTON HIGHWAY MARION COUNTY


Design Team Leader - Carol Cartwright Designed By - John Lucas Drafted By - Charlotte Gerken


DRAINAGE NOTES


5B-2


1159/19762 - 003

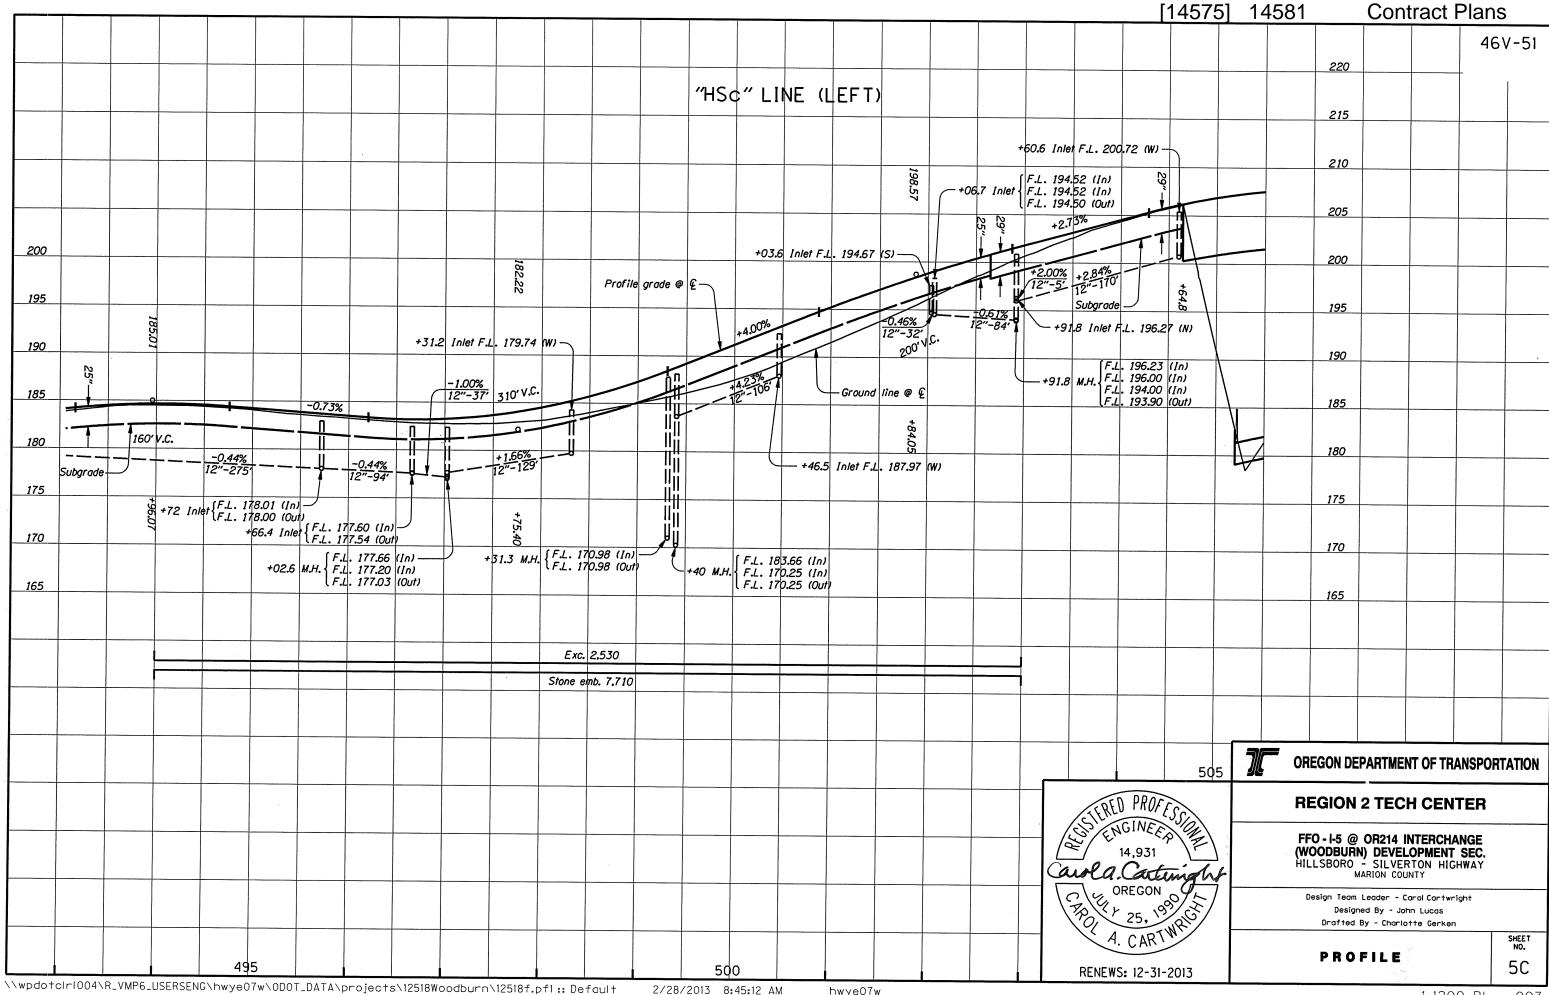

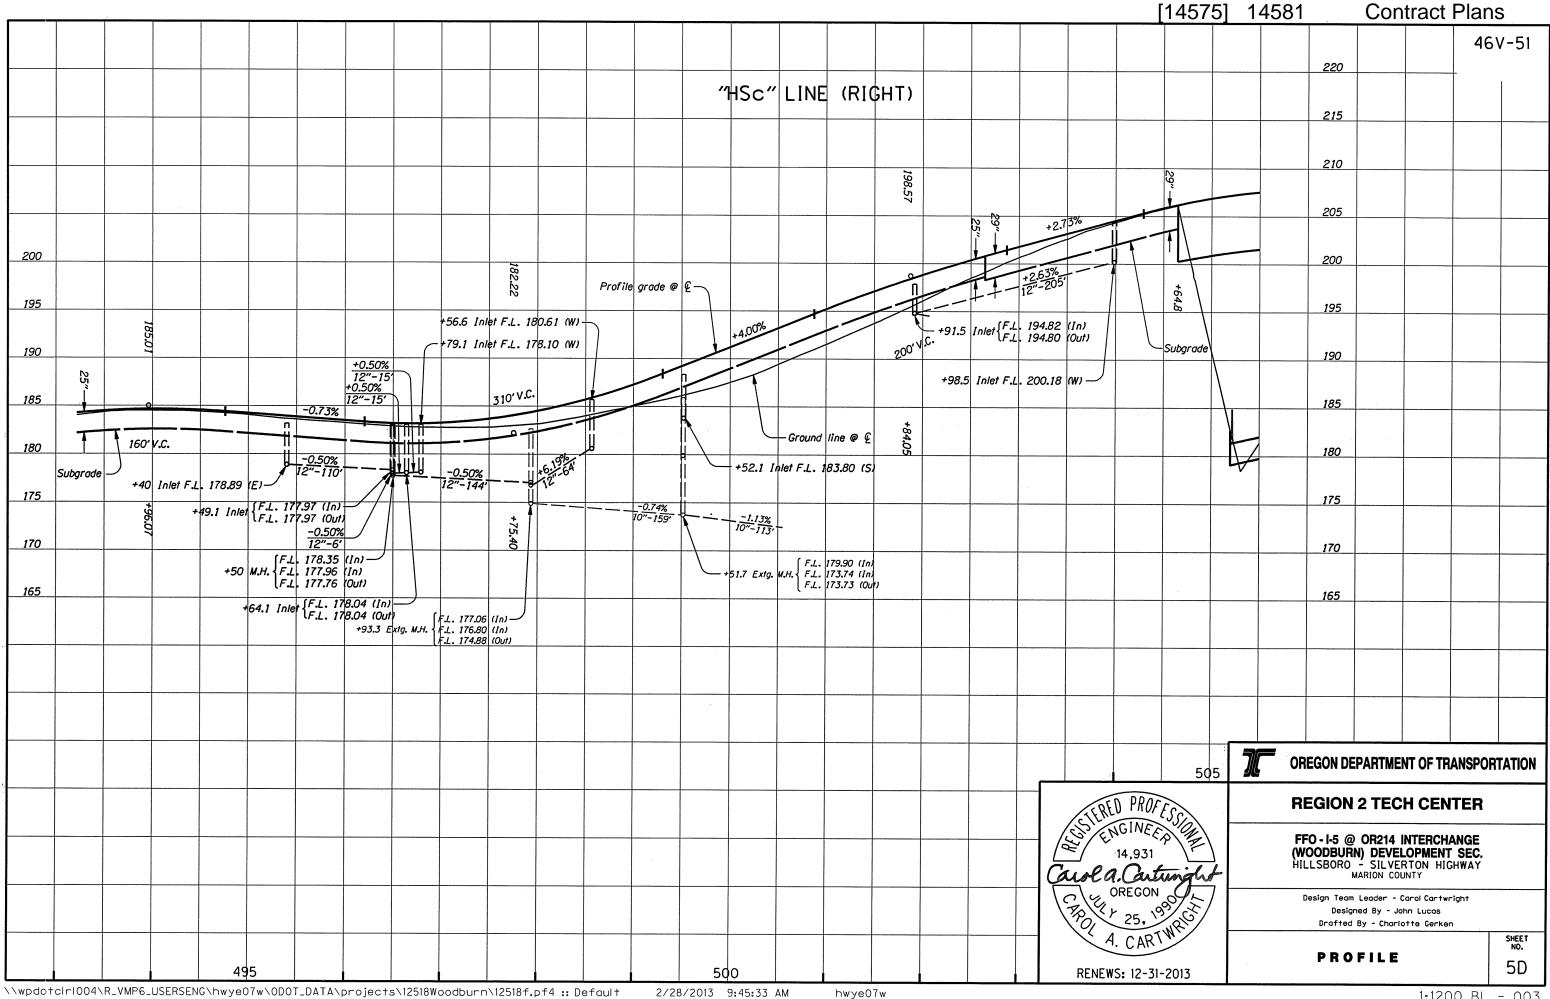


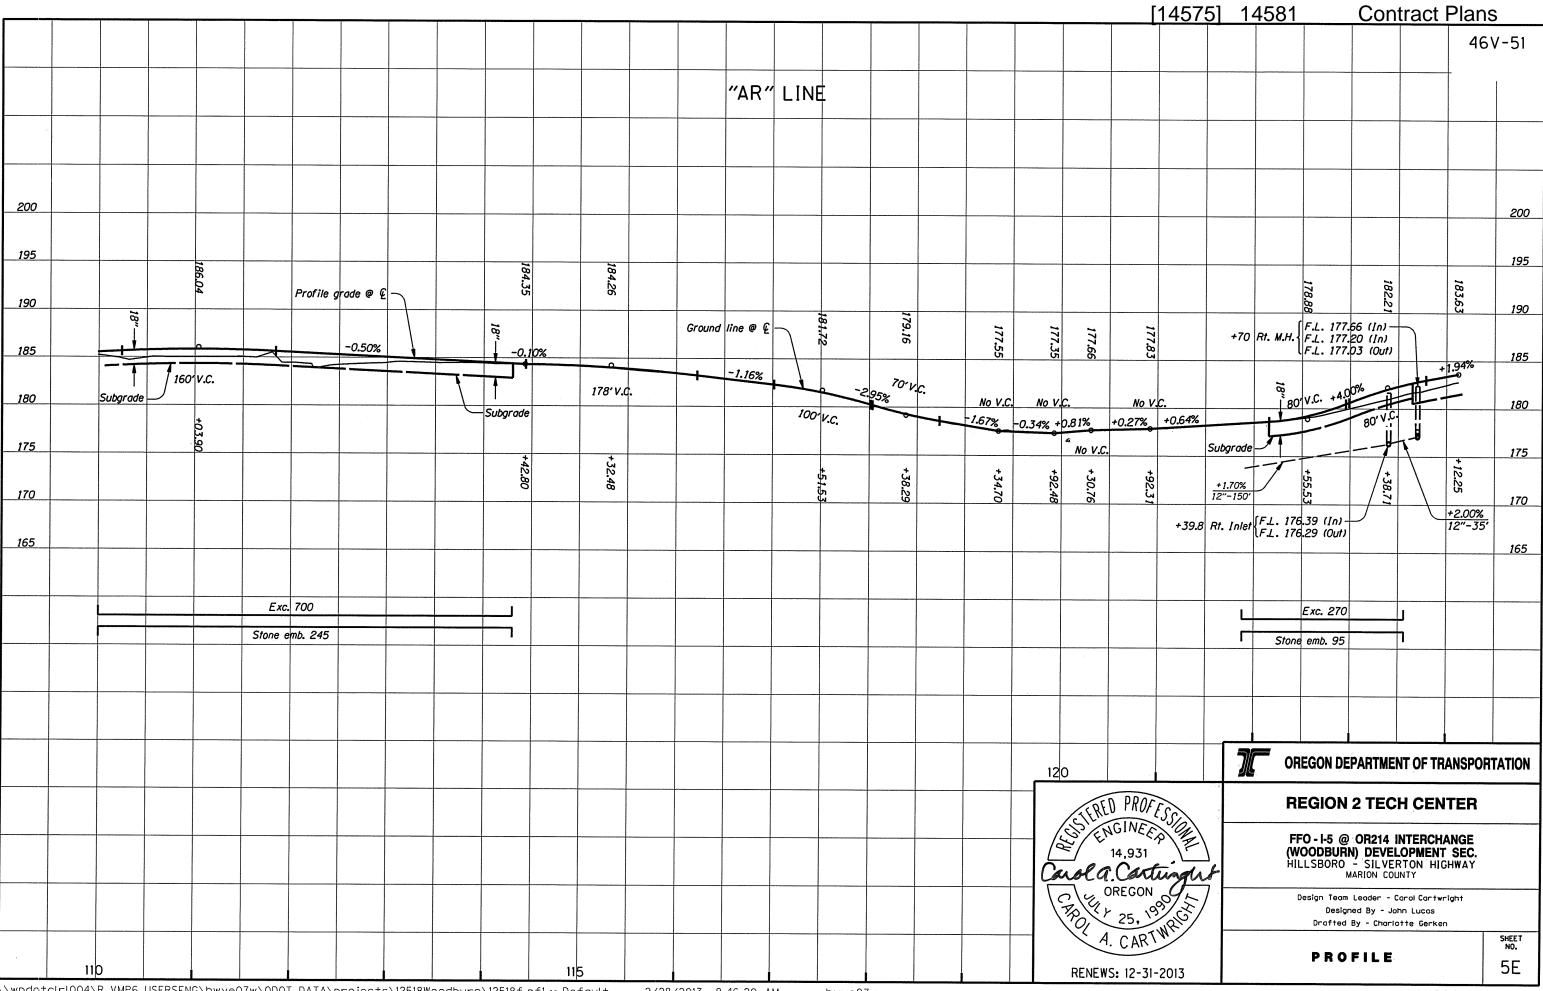

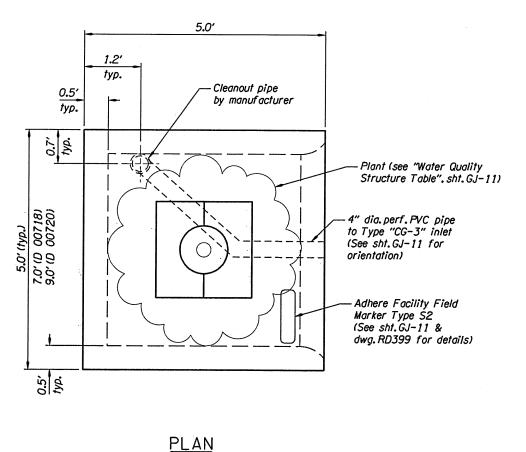

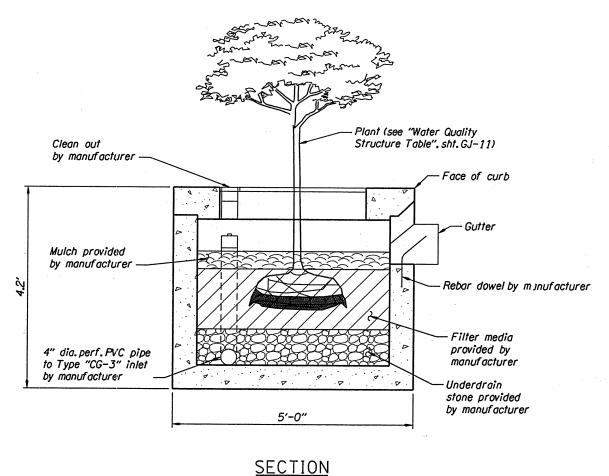


WATER QUALITY STRUCTURE DETAILS

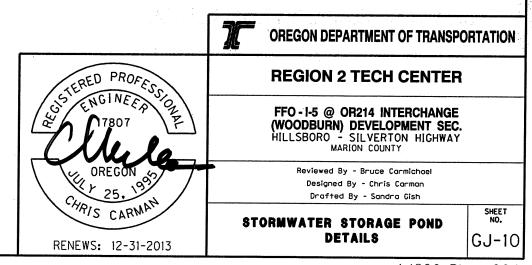


46V-51

| WATER QUALITY STRUCTURE TABLE | | | | | |
|-------------------------------|------------------|---------|----------------------------|--|--|
| DRAINAGE FACILITY I.D. MARKER | "HSC" STATION | LT./RT. | OUTLET PIPE ORIENTATION | STORMWATER CONTROL FACILITY TREATMENT CATEGORY | |
| D 00728 | 477+60.16 | Lt. | С | Clara Snow Indian Hawthorne | |
| D 00685 | 478+68.93 | Lt. | С | Clara Snow Indian Hawthorne | |
| D 00686 | 478+68.84 | Rt. | В | Clara Snow Indian Hawthorne | |
| D 00687 | 479+94.84 | Lt. | Α | Clara Snow Indian Hawthorne | |
| D 00688 | 479+95.27 | Rt. | В | Clara Snow Indian Hawthorne | |
| D 00689 | 480+05.15 | Lt. | С | Clara Snow Indian Hawthorne | |
| D 00690 | 480+05.61 | Rt. | В | Clara Snow Indian Hawthorne | |
| D 00691 | 482+39.81 | Lt. | Α | Clara Snow Indian Hawthorne | |
| D 00692 | 482+44.59 | Rt. | В | Clara Snow Indian Hawthorne | |
| D 00693 | 483+95.23 | Lt. | Α | Clara Snow Indian Hawthorne | |
| D 00694 | 483+94.29 | Rt. | В | Clara Snow Indian Hawthorne | |
| D 00695 | 485+95.41 | Lt. | Α | Clara Snow Indian Hawthorne | |
| D 00696 | 485+94.51 | Rt. | В | Clara Snow Indian Hawthorne | |
| D 00697 | 487+43.91 | Lt. | Α | Clara Snow Indian Hawthorne | |
| D 00698 | 487+45.01 | Rt. | В | Clara Snow Indian Hawthorne | |
| D 00699 | 488+94.27 | Lt. | Α | Clara Snow Indian Hawthorne | |
| D 00700 | 488+94.79 | Rt. | В | Rose Creek Abelia | |
| D 00701 | 489+93.83 | Lt. | Α | Rose Creek Abelia | |
| D 00702 | 489+93.83 | Rt. | С | Rose Creek Abelia | |
| D 00703 | 490+34.17 | Lt. | С | Rose Creek Abelia | |
| D 00704 | 490+34.16 | Rt. | Α | Rose Creek Abelia | |

| | WATER Q | UALITY S | TRUCTURE TA | BLE CONT. |
|----------------------------------|------------------|----------|----------------------------|--|
| DRAINAGE FACILITY I.D. MARKER | "HSC" STATION | LT./RT. | OUTLET PIPE ORIENTATION | STORMWATER CONTROL FACILITY TREATMENT CATEGORY |
| D 00705 | 493+01.74 | Lt. | С | Rose Creek Abelia |
| D 00706 | 493+24.46 | Rt. | Α | Rose Creek Abelia |
| D 00707 | 495+66.83 | Lt. | Α | Rose Creek Abelia |
| D 00708 | 495+34.83 | Rt. | В | Rose Creek Abelia |
| D 00709 | 496+61.16 | Lt. | Α | Rose Creek Abelia |
| D 00710 | 496+44.84 | Rt. | С | Rose Creek Abelia |
| D 00711 | 496+83.32 | Rt. | A | David Viburnmum |
| D 00712 | 498+36.46 | Lt. | С | David Viburnmum |
| D 00713 | 498+60.63 | Rt. | Α | David Viburnmum |
| D 00714 | 499+57.23 | Rt. | В | David Viburnmum |
| D 00715 | 500+51.62 | Lt. | С | David Viburnmum |
| D 00716 | 538+24.42 | Lt. | Α | David Viburnmum |
| D 00717 | 538+99.37 | Lt. | Α | David Viburnmum |
| D 00718 | 540+24.36 | Lt. | Α | David Viburnmum |
| D 00719 | 540+86.99 | Lt. | С | David Viburnmum |
| D 00720 | 542+74.86 | Lt. | Α | David Viburnmum |
| D 00721 | 543+18.11 | Rt. | В | David Viburnmum |
| D 00722 | 543+40.64 | Lt. | Α | David Viburnmum |
| D 00723 | 543+64.85 | Rt. | С | David Viburnmum |
| D 00724 | 543+8).96 | Lt. | С | David Viburnmum |

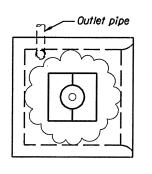

— Outlet pipe

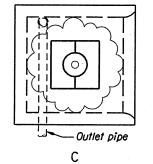


D 00725

543+90.18

Rt.

<u>OUTLET PIPE ORIENTATIONS</u>

WATER QUALITY STRUCTURE DETAILS

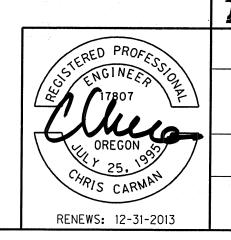

David Viburnmum

OREGON DEPARTMENT OF TRANSPORTATION

REGION 2 TECH CENTER

FFO - 1-5 @ OR214 INTERCHANGE (WOODBURN) DEVELOPMENT SEC. HILLSBORO - SILVERTON HIGHWAY MARION COUNTY

Reviewed By - Bruce Carmichael Designed By - Chris Carman Drafted By - Sandra Gish

STORMWATER STORAGE POND **DETAILS**

SHEET NO. GJ-11